

- **HESITATION—ON DRIVEAWAY—1.6L—AUTOMATIC TRANSMISSION**
- **STALL—ON “DRIVE” ENGAGEMENT—1.6L—AUTOMATIC TRANSMISSION**
- **STUMBLE—ON DRIVEAWAY OR TIP-IN—1.6L—MANUAL TRANSMISSION**

**Article No.
90-23-5**

LINCOLN-MERCURY: 1991 CAPRI

ISSUE

Hesitation, stall or stumble on “Drive” engagement or on driveaway may be caused by a poor connection at the 14401 and 12A522 wiring harnesses.

ACTION

Check the wiring connections at the engine ECC processor, Figure 1. Refer to the following procedure for service details.

1. Locate the main wiring harness (14401) and the engine control wiring harness (12A522) in the engine compartment, Figure 2.
2. See if the main wiring harness engineering part number is 90JA-14401-CF and the engine control wiring harness engineering part number is 90JA-12A522-AB.
 - a. If the wiring harness part numbers are correct, **DO NOT** continue with this TSB article.
 - b. If the wiring harness part numbers are not as listed above, proceed with the wiring harness service procedure.

WIRING HARNESS SERVICE PROCEDURE

MANUAL TRANSMISSIONS

1. Remove the RH trim cover from the center console.
2. Make sure that the male and female connectors are connected, Figure 1.

3. Install the RH trim cover on the center console.

AUTOMATIC TRANSMISSIONS

1. Remove the RH trim cover from the center console.
2. Cut the male terminal from the wire.
3. Tape the cut end of the wire to the loom, Figure 1.
4. Tape the female terminal to the loom.
5. Install the RH trim cover on the center console.

PART NUMBER	PART NAME
C8AZ-19628-D	Electrical Tape

OTHER APPLICABLE ARTICLES: None
WARRANTY STATUS: Eligible Under Basic Warranty Coverage

OPERATION	DESCRIPTION	TIME
902305A	Inspect Harness Part Numbers Only	0.2 Hr.
902305B	Inspect & Correct	0.3 Hr.

DEALER CODING

BASIC PART NO.	CONDITION CODE
12A522	79
OASIS CODES: 203000, 203200, 607000, 611000, 607400	

Article No. 90-23-5 Cont'd.

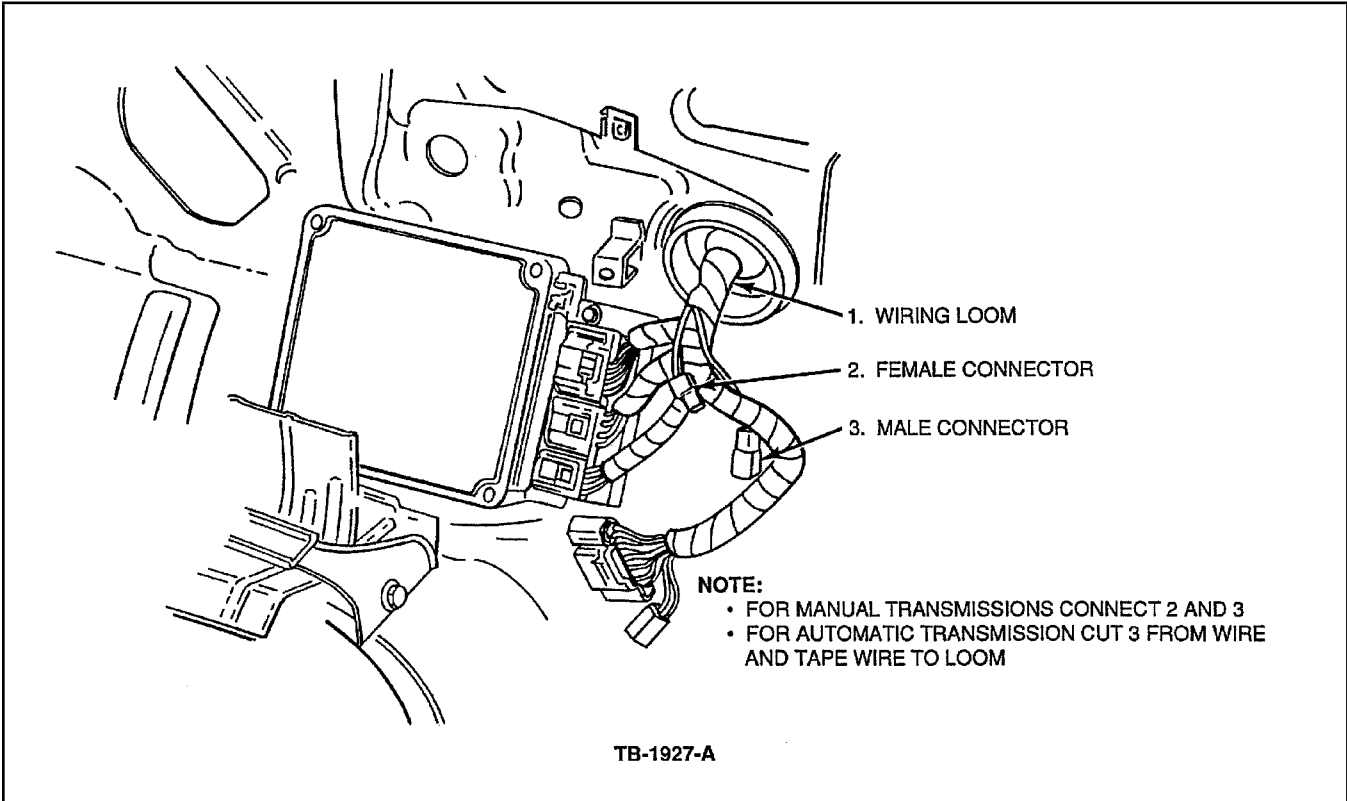


Figure 1 - Article 90-23-5

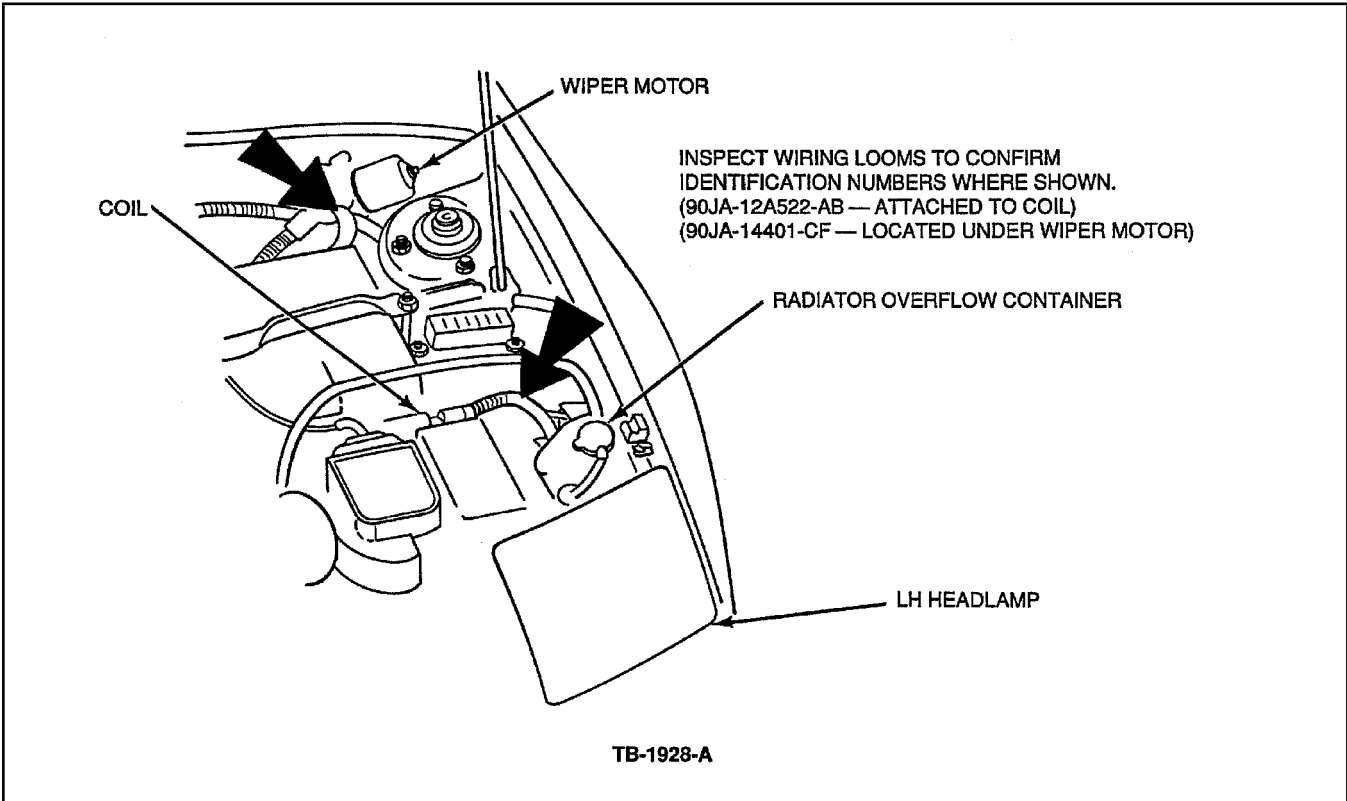


Figure 2 - Article 90-23-5