

- **MIRRORS—OUTSIDE REAR VIEW—RATTLE OR VIBRATION**
- **NOISE—“RATTLE” OR VIBRATION FROM OUTSIDE REAR VIEW MIRRORS**

**Article No.
91-10-3**

MERCURY: 1991 CAPRI

ISSUE

The outside rear view mirrors may rattle or vibrate. This occurs because the upper part of the rear location “nibs” do not allow a flush fit.

ACTION

Modify the location “nibs” to permit a better fit. Refer to the following procedure for service details.

1. Inspect the mirror assembly by lightly pulling on the mirror head to see if it wobbles.
2. If the mirror head wobbles, pull the mirror head forward to expose the location “nibs”, Figure 1.
3. File the upper part of the rear location nib until the wobble is no longer apparent.

CAUTION

DO NOT REMOVE THE COMPLETE “NIB”. BE SURE THAT ONLY THE UPPER PART OF THE “NIB” IS FILED. TAKE CARE TO PROTECT THE MIRROR SURFACE FROM SCRATCHES.

OTHER APPLICABLE ARTICLES: NONE

WARRANTY STATUS: Eligible Under Basic Warranty Coverage

OPERATION	DESCRIPTION	TIME
911003A	Modify Mirror Location Nibs	0.3 Hr.

DEALER CODING

BASIC PART NO.
17682

OASIS CODES: 103000

CONDITION CODE
67

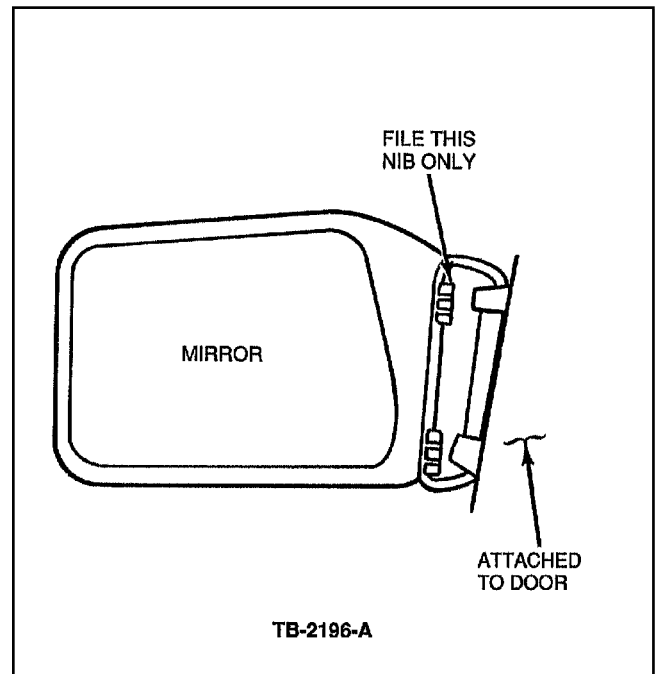


Figure 1 - Article 91-10-3