

- **AIR CLEANER—CONTACTS TRANSMISSION COVER**
- **NOISE—“POP” FROM ENGINE COMPARTMENT**

**Article No.
91-16-11**

MERCURY: 1991 CAPRI

ISSUE

A loud “Pop” from the engine compartment may be caused by the engine air cleaner contacting the automatic transmission cover. Engine operation is not affected.

ACTION

Install washers under the mounting points of the air cleaner assembly to provide more clearance. Refer to the following procedure for service details.

1. Remove the air cleaner assembly. Refer to the 1991 Capri Shop Manual, Page 24-41-2, for removal procedure.
2. Install a 3mm thick washer (E630028-S71) under each of the three (3) mounting points of the air cleaner assembly.

3. Replace the air cleaner assembly. Tighten the mounting bolts to 4.4-8 lb-ft (6-11 N•m).

PART NUMBER	PART NAME
E630028-S71	Washers

OTHER APPLICABLE ARTICLES: NONE
WARRANTY STATUS: Eligible Under Basic Warranty Coverage

OPERATION	DESCRIPTION	TIME
911611A	Shim Air Cleaner Assembly	0.4 Hr.

DEALER CODING

BASIC PART NO.
9600

OASIS CODES: 497000, 702000

CONDITION CODE
35