

- **LEAKS—COOLANT FROM RADIATOR HOSES AT THERMOSTAT HOUSING OR WATER PUMP END—VEHICLES BUILT PRIOR TO 7/25/91**
- **RADIATOR—AVAILABILITY OF NEW HOSE CLAMPS WITH A HIGHER CLAMPING FORCE—VEHICLES BUILT PRIOR TO 7/25/91**

**Article No.
91-25-11**

MERCURY: 1991-1992 CAPRI

ISSUE

Coolant may leak from the radiator hose connections at the thermostat housing or the water pump end. This may occur because the hose clamp does not have enough clamping force.

ACTION

Replace the existing radiator hose clamps with new clamps (F1JY-8287-A) which have a higher clamping force.

NOTE

THIS NEW STRONGER HOSE CLAMP (F1JY-8287-A) IS NOT SUITABLE FOR RADIATOR HOSE CONNECTIONS TO THE RADIATOR ITSELF.

OTHER APPLICABLE ARTICLES: NONE

WARRANTY STATUS: Eligible Under Basic Warranty Coverage For 1990/91 Models, Bumper To Bumper For 1992 Models

OPERATION	DESCRIPTION	TIME
912511A	Replace Radiator Hose Clamp.	0.3 Hr.

DEALER CODING

BASIC PART NO.	CONDITION CODE
8287	63

OASIS CODES: 402000, 490000, 499000

PART NUMBER	PART NAME
F1JY-8287-A	Radiator Hose Clamp