

**SPEEDOMETER—INOPERATIVE OR INACCURATE—  
CABLE DAMAGED—VEHICLES BUILT BEFORE  
7/23/90**

**Article No.  
92-13-9**

**MERCURY: 1991 CAPRI**

**ISSUE**

An inoperative or inaccurate speedometer may be caused by a speedometer cable that is kinked or broken.

**ACTION**

Inspect the speedometer cable for kinks or breakage. Replace the cable if it is damaged. Refer to the following procedure for service details.

1. Check speedometer operation for signs of improper operation.
2. Inspect speedometer cable for kinks or breakage.
3. Replace the speedometer cable if there are any signs of damage. Refer to page 33-10-3 of the 1991 Capri Shop Manual for service details.

**NOTE**

**TORQUE SPEEDOMETER CABLE CONNECTION AT TRANSAXLE TO 3-5 LBS.-FT. (4-7 N•m).**

4. Reroute speedometer cable. Refer to Figure 1.
5. Secure the speedometer cable to the brake master cylinder with a tie strap. Refer to Figure 1.

PART NUMBER	PART NAME
F1JY-17260-A 95874-S	Speedometer Cable Tie Strap

**WARRANTY STATUS:** Eligible Under Basic Warranty Coverage


OPERATION	DESCRIPTION	TIME
921309A	Inspect Speedometer Cable	0.3 Hr.
921309B	Inspect and Replace Speedometer Cable	0.8 Hr.

**DEALER CODING**

BASIC PART NO.  
17260

**OASIS CODES:** 204000, 204200

CONDITION  
CODE  
02

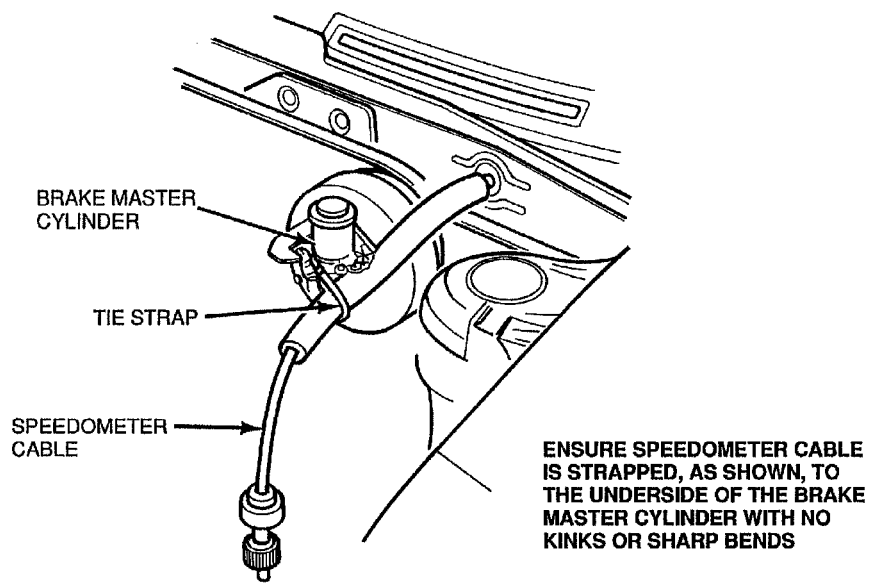

TB-2371-A

Figure 1 - Article 92-13-9