

**FUEL SYSTEM—FILLER CAP SEPARATION—  
VEHICLES BUILT FROM JOB 1 TO 6/1/91**

**Article No.  
92-8-7**

**MERCURY:** 1991-1992 CAPRI

**ISSUE**

The fuel filler cap cover may separate from the threaded pressure vent assembly. If the cover separates from the threaded assembly, the seal and retaining threads may remain in the fill pipe and can be sealed by tightening.

**ACTION**

Replace the fuel filler cap assembly.

**CAUTION**

**NO ATTEMPT SHOULD BE MADE TO MODIFY OR REASSEMBLE AN EXISTING FUEL FILLER CAP WHICH HAS SEPARATED. IF THE SEPARATION CONDITIONS OCCURS, REPLACE THE FUEL FILLER CAP ASSEMBLY WITH ONE WHICH HAS A MANUFACTURING DATE STAMP AFTER MAY 7, 1991. REFER TO FIGURES 1 AND 2.**

**NOTE**

**ALL FUEL FILLER CAPS ARE DATE STAMPED AT THE BASE OF THE CAP INDICATING YEAR,**

**MONTH AND DAY OF MANUFACTURE. REFER TO FIGURE 2 FOR IDENTIFICATION.**

| PART NUMBER | PART NAME                |
|-------------|--------------------------|
| FOJY-9030-A | Fuel Filler Cap Assembly |

**OTHER APPLICABLE ARTICLES:** NONE

**WARRANTY STATUS:** Eligible Under Basic Warranty Coverage For 1991 Models, Bumper To Bumper For 1992 Models, Emissions Warranty Coverage

| OPERATION | DESCRIPTION             | TIME    |
|-----------|-------------------------|---------|
| 920807A   | Replace Fuel Filler Cap | 0.2 Hr. |

**DEALER CODING**

|                        |                         |
|------------------------|-------------------------|
| BASIC PART NO.<br>9030 | CONDITION<br>CODE<br>01 |
|------------------------|-------------------------|

**OASIS CODES:** 404000

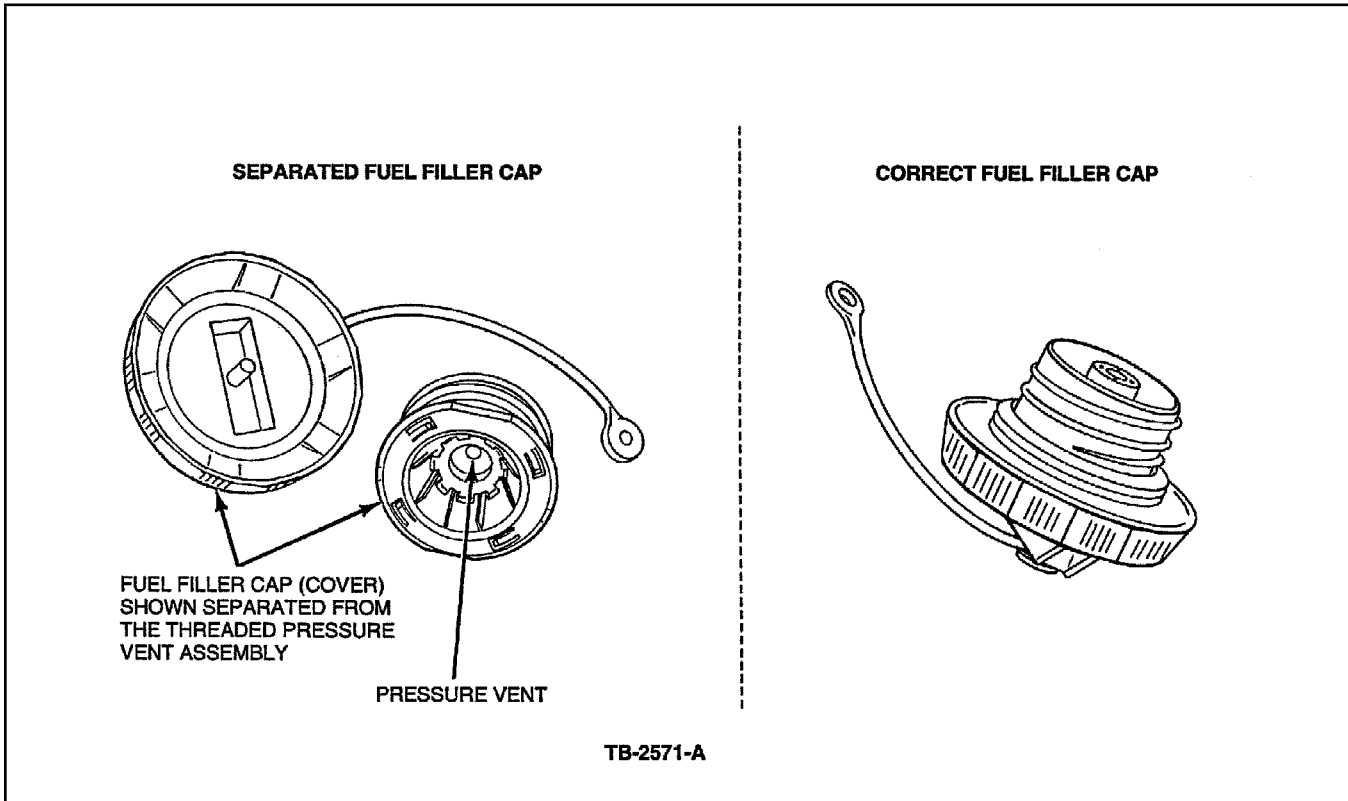


Figure 1 - Article 92-8-7

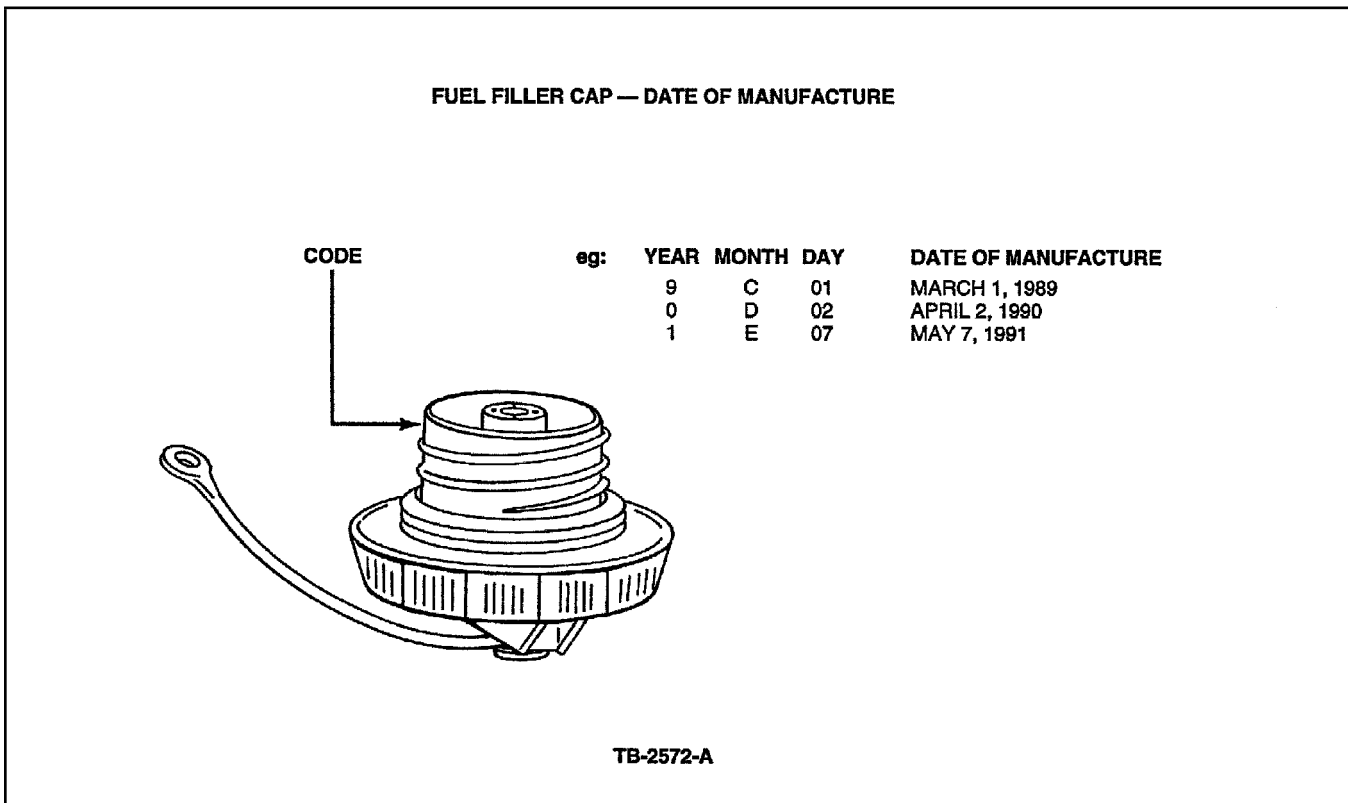


Figure 2 - Article 92-8-7