

FUSE—WINDSHIELD WIPERS—BLOWS IN FREEZING TEMPERATURES

Article No.
93-20-7

MERCURY: 1991-1993 CAPRI

ISSUE

The “wiper” fuse may electrically blow when attempting to operate the windshield wipers while the wipers blades are frozen to the glass.

ACTION

Change the “wiper” fuse to a 25 amp fuse to correct the condition. Replace the interior fuse panel decal to reflect the 25 amp fuse. Refer to the following procedure for service details.

1. Replace the “wiper” fuse (15 amp or 20 amp) with a 25 amp fuse (D9ZZ-14526-F).
2. Replace the interior fuse panel decal with a new decal (F1JY-14A003-A) which designates a 25 amp fuse for the windshield wipers, Figure 1.

NOTE

THE NEW FUSE PANEL DECAL ALSO DESIGNATES A 25 AMP FUSE FOR THE COOLING FAN. ENSURE THAT THE VEHICLE HAS BEEN FITTED WITH A 25 AMP COOLING FAN FUSE OR UPGRADE AS REQUIRED (REFER TO TSB 92-7-7 FOR DETAILS).

3. Change the Owner’s Manual (page 239 for 1991 models, page 245 for 1992 models and page 244 for 1993 models) to show 25 amp fuses for cooling fan and wipers. Check windshield wipers for normal operation to ensure that no other fault causes the wiper fuse to blow.

PART NUMBER	PART NAME
F1JY-14A003-A	Decal - Fuse Panel Cover
D9ZZ-14526-F	25 Amp (Blade) Fuse

OTHER APPLICABLE ARTICLES: 92-7-7

WARRANTY STATUS: Eligible Under Bumper To Bumper Warranty Coverage For 1992/93 Models, And Basic Warranty Coverage For All Other Models

OPERATION	DESCRIPTION	TIME
932007A	Install New Fuse and Fuse Cover Sticker	0.2 Hr.

DEALER CODING

BASIC PART NO.	CONDITION CODE
14526	79

OASIS CODES: 202000, 203000, 203200

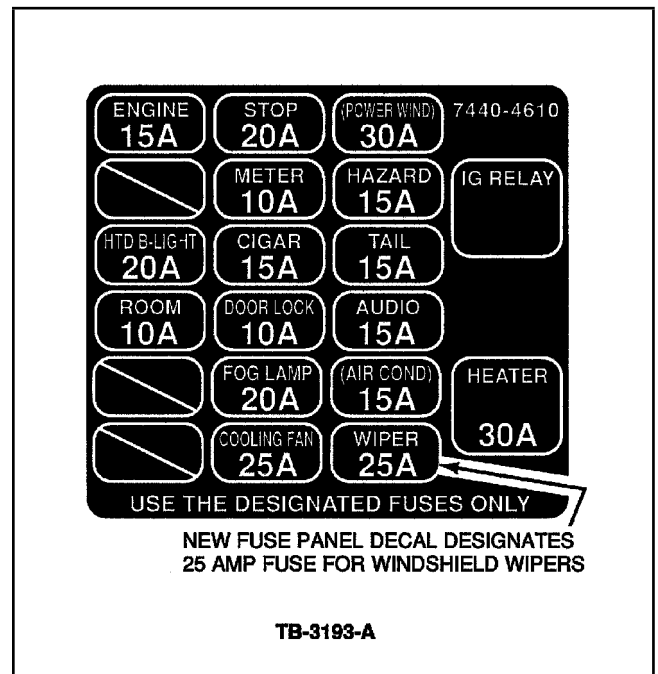


Figure 1 - Article 93-20-7