

**TURN SIGNAL—LEVER—WILL NOT STAY ENGAGED  
DURING RIGHT HAND TURN—VEHICLES BUILT  
BEFORE JANUARY 20, 1993**

**Article No.  
93-21-7**

**MERCURY:** 1991-1993 CAPRI

**ISSUE**

The turn signal lever will not stay engaged, when making a right hand turn, which switches off the turn signal.

**ACTION**

Replace the turn signal switch with a new level switch. Refer to the following procedure for service details.

**REMOVAL - PROCEDURE**

1. Disconnect negative battery cable.
2. Remove center trim panel and access cover beneath steering column.
3. Remove lower steering column shroud.
4. Remove column upper retaining bolts.

**NOTE**

**STEERING COLUMN WILL REST ON INSTRUMENT PANEL BRACE.**

**CAUTION**

**ENSURE NO WIRES ARE PINCHED WHEN LOWERING OR REPOSITIONING STEERING COLUMN.**

5. Remove two switch retaining screws and remove switch.
6. Grasp switch and lever firmly; pull lever out of switch.
7. Disconnect electrical connectors from switch.

**INSTALLATION - PROCEDURE**

1. Align key with slot and install lever in switch assembly (F33Z-13341-B).

2. Connect connectors to switch assembly.
3. Position switch on steering column and install retaining screws.
4. Make sure column support bracket is in position. Raise column into position and install retaining bolts. Tighten to 23-31 N•m (17-22 lb-ft).
5. Install lower column shroud.
6. Install access cover and trim panel.
7. Connect negative battery terminal.
8. Check for proper operation.

PART NUMBER	PART NAME
F33Z-13341-B	Turn Signal Switch

**OTHER APPLICABLE ARTICLES:** NONE

**WARRANTY STATUS:** Eligible Under Basic Warranty Coverage For 1991, Bumper To Bumper Warranty Coverage For 1992 Models

OPERATION	DESCRIPTION	TIME
932107A	Replace Turn Signal Switch Assembly	0.4 Hr.

**DEALER CODING**

BASIC PART NO.	CONDITION CODE
13341	46

**OASIS CODES:** 201000, 201200, 206000