

- **LOCKS—IGNITION—DEALERSHIP CUT KEYS DO NOT WORK IN IGNITION—ROTUNDA KEY BLANKS SOLD PRIOR TO 3/1/91**
- **IGNITION SWITCH—DEALERSHIP CUT KEYS DO NOT WORK IN IGNITION—ROTUNDA KEY BLANKS SOLD PRIOR TO 3/1/91**

**Article No.  
92-5-3**

**MERCURY:** 1991-1992 CAPRI

### **ISSUE**

Some dealership-cut ignition keys may open the doors but not engage the ignition, thus preventing the car from starting. This is caused by a shoulder on the blade of the key blank #011-00155, Figure 1.

### **ACTION**

Remove the excess metal from the key blade, as shown in Figure 1. Use a file or key duplicator. To order key blanks, call the Rotunda Hotline: 1-800-762-6181 (Rotunda Dealership Supplies - Option 2).

**OTHER APPLICABLE ARTICLES:** NONE

**SUPERSEDES:** 91-1-3

**WARRANTY STATUS:** INFORMATION ONLY

**OASIS CODES:** 112000

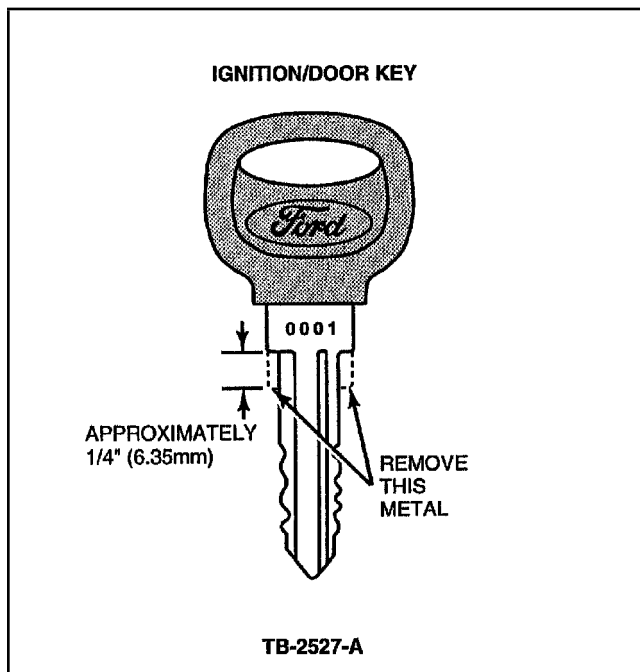


Figure 1 - Article 92-5-3