

- **WINDNOISE/WATER LEAKS—IMPROVED WEATHERSTRIP SEALING**
- **WINDNOISE/WATER LEAKS—VEHICLE WEATHERSTRIP UPDATE—IMPROVED SEALING AROUND TOP AND SIDE WINDOW AREAS**

**Article No.
94-7-4**

MERCURY: 1991-1994 CAPRI

ISSUE

Maximum sealing against water leaks may not be achieved unless the correct level of weatherstrip is fitted to the vehicle.

ACTION

Refer to Figure 1 for a diagram and chart confirming the latest level of weatherstrips, as well as weatherstrip interchangeability across model years. Additional important service literature is also referenced in this TSB article.

ADDITIONAL SERVICE INFORMATION AND LITERATURE

1. FRONT WINDOW CHANNEL/QUARTER WINDOW ASSEMBLY
 - If an older level front window channel/quarter window assembly requires replacement (i.e. on vehicles built before July 15, 1992), a new windshield header weatherstrip should also be fitted.

NOTE

GLASS ADJUSTMENT PROCEDURES ARE AS LISTED IN SECTION 01-11 OF THE 1994 CAPRI SERVICE MANUAL; HOWEVER, THE FORE AND AFT ADJUSTMENT SETTING IS 7.0mm (0.28") FOR LATE LEVEL FRONT WINDOW CHANNEL/QUARTER WINDOW ASSEMBLIES.


2. WINDSHIELD HEADER WEATHERSTRIP
 - Refer to TSB 94-7-3 for windshield header weatherstrip replacement procedures on vehicles built before June 1993. Additionally, glass adjustment settings should be checked and adjusted as necessary in accordance with the procedures listed in the 1994 Capri Service Manual, Section 01-11.

3. FRONT SIDE RAIL WEATHERSTRIPS
 - Refer to Attachment III of Service Program Number 92B07 for replacement procedures.

PART NUMBER	PART NAME
F2JY-7621616-C	Front Window Channel/Quarter Window Assy
F2JY-7621617-C	Front Window Channel/Quarter Window Assy
F4JY-7651338-A	W/S Header W/strip
FOJY-7620708-A	Door W/strip
FOJY-7620709-A	Door W/strip
F2JY-7620708-A	Door W/strip
F2JY-7620709-A	Door W/strip
E9JY-7653986-B	Frnt Side Rail W/strip
E9JY-7653987-B	Frnt Side Rail W/strip
F2JY-7653986-A	Frnt Side Rail W/strip
F2JY-7653987-A	Frnt Side Rail W/strip
FOJY-7651566-A	Rear Side Rail W/strip
FOJY-7651567-A	Rear Side Rail W/strip
F2JY-7651566-A	Rear Side Rail W/strip
F2JY-7651567-A	Rear Side Rail W/strip
FOJY-7651566-C	B-Pillar W/strip
FOJY-7651567-C	B-Pillar W/strip
F2JY-7651566-B	B-Pillar W/strip
F2JY-7651567-B	B-Pillar W/strip
FOJY-76404A06-K	Conv. Top Storage Lid W/strip
FOJY-76404A06-L	Conv. Top Storage Lid W/strip

OTHER APPLICABLE ARTICLES: 94-7-3
WARRANTY STATUS: INFORMATION ONLY
OASIS CODES: 102000, 108000, 110000, 701000

LATEST LEVEL VEHICLE WEATHERSTRIPS

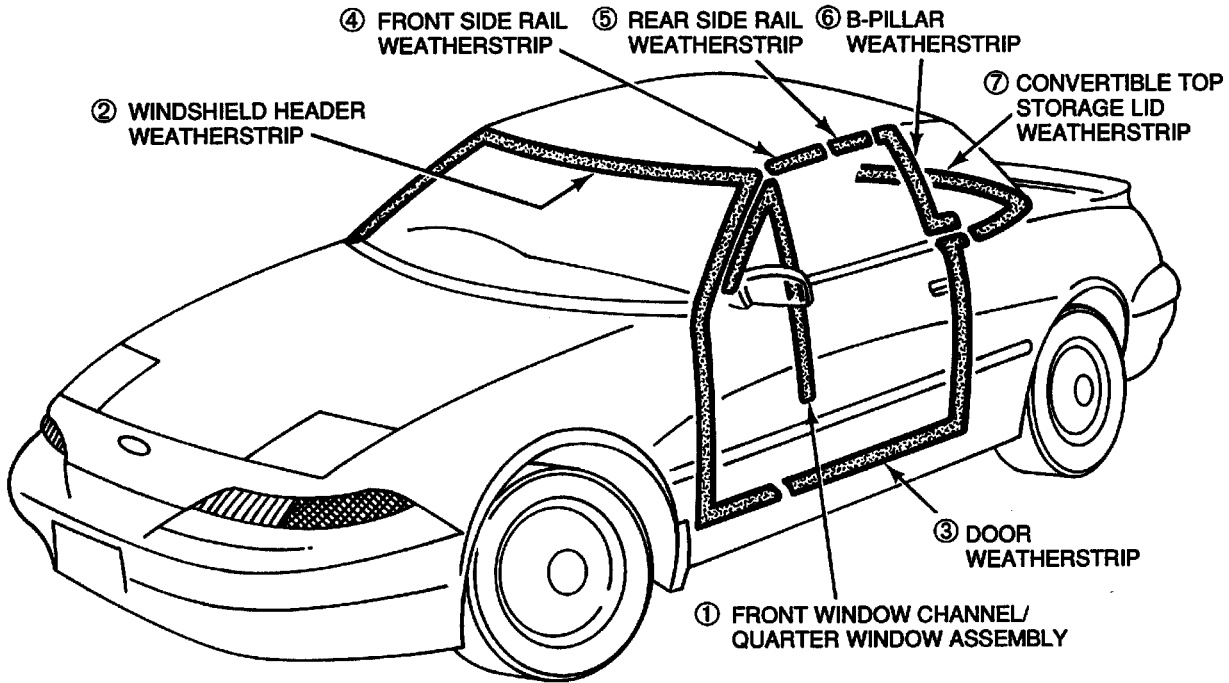

REFERENCE # AND PART DESCRIPTION	P&A PART #	COMPONENT INTERCHANGEABILITY ACROSS MODEL RANGE			
		91 MY	92 MY	93 MY	94 MY
① FRT WDW CHANNEL/ QTR WDW ASSY.	F2JY-7621616-C F2JY-7621617-C	Y Y	Y Y	Y Y	Y Y
② WINDSHIELD HEADER WEATHERSTRIP	F4JY-7651338-A	Y + TSB 94-7-3 AND TSB 94-7-4	Y + TSB 94-7-3 AND TSB 94-7-4	Y + TSB 94-7-3 AND TSB 94-7-4	Y
③ DOOR WEATHERSTRIP	FOJY-7620708-A FOJY-7620709-A F2JY-7620708-A F2JY-7620709-A	Y Y N N	Y Y N N	Y Y N N	N N Y Y
④ FRONT SIDE RAIL WEATHERSTRIP	E9JY-7653986-B E9JY-7653987-B F2JY-7653986-A F2JY-7653987-A	Y Y N N	Y Y N N	Y TO 7/92 Y TO 7/92 Y FROM 7/92 Y FROM 7/92	N N Y Y
⑤ REAR SIDE RAIL WEATHERSTRIP	FOJY-7651566-A FOJY-7651567-A F2JY-7651566-A F2JY-7651567-A	Y Y N N	Y Y N N	Y TO 7/92 Y TO 7/92 Y FROM 7/92 Y FROM 7/92	N N Y Y
⑥ B-PILLAR WEATHERSTRIP	FOJY-7651566-C FOJY-7651567-C F2JY-7651566-B F2JY-7651567-B	Y Y N N	Y Y N N	Y TO 7/92 Y TO 7/92 Y FROM 7/92 Y FROM 7/92	N N Y Y
⑦ CONV.TOP STORAGE LID WEATHERSTRIP	FOJY-76404A06-K FOJY-76404A06-L	Y N	Y N	Y N	N Y

TB-3533-A

Figure 1 - Article 94-7-4